


Carbide Series 300R Microphone/Headphone jack switch

Some 300R units were shipped with reversed headphone and microphone ports on the front panel. The audio jacks work normally if you plug the headset into the microphone port and vice versa, but if you'd like the labels to be correct on the front of the case, there's a fairly simple 5-minute fix you can do to reverse the ports.

Step 1 – remove the front panel by putting your hand underneath it and pulling firmly but gently until the case's front panel comes off.




Step 2 – Using a standard Philips-head screwdriver, remove the two screws on either side of the I/O panel.

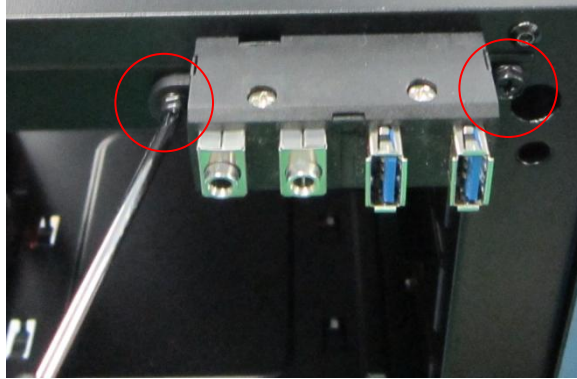


Step 3 – Pull the I/O panel out from the side, angling it like this.




Step 4 – Using a Philips-head screwdriver, unscrew the two silver screws on top of the I/O panel.

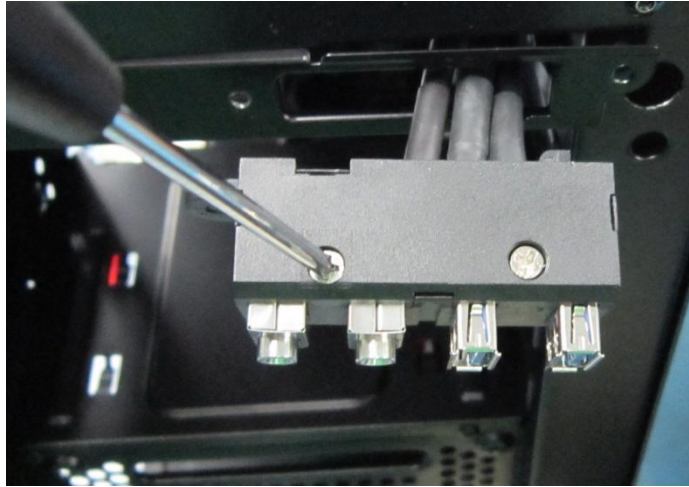


Step 5 – Using a small flathead screwdriver, pry the top piece off carefully from the four plastic clasp points.

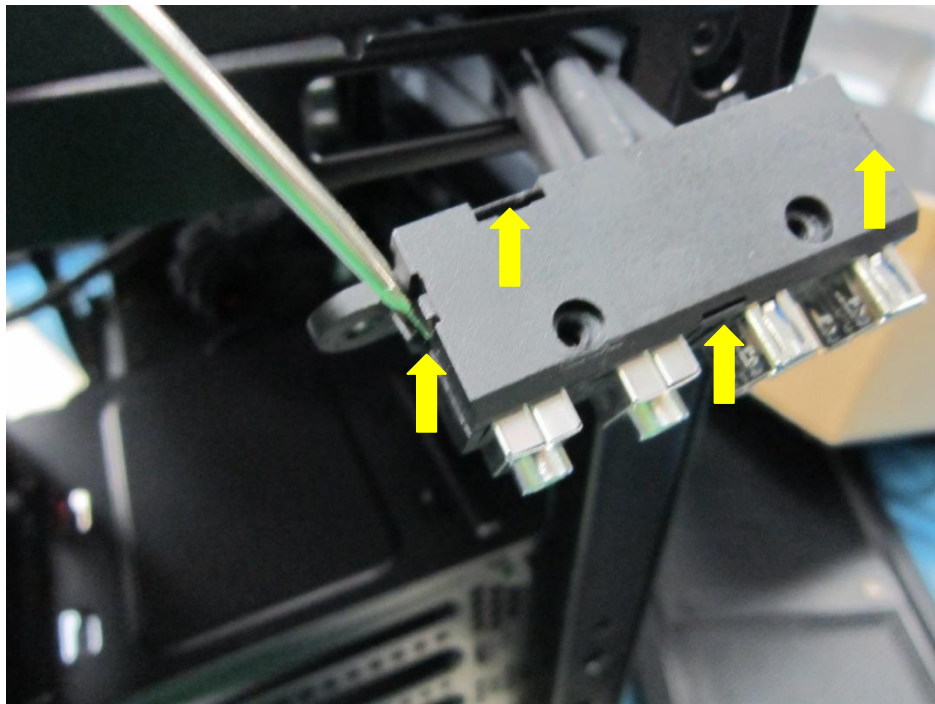

Step 6 – Carefully remove the I/O panel cover.

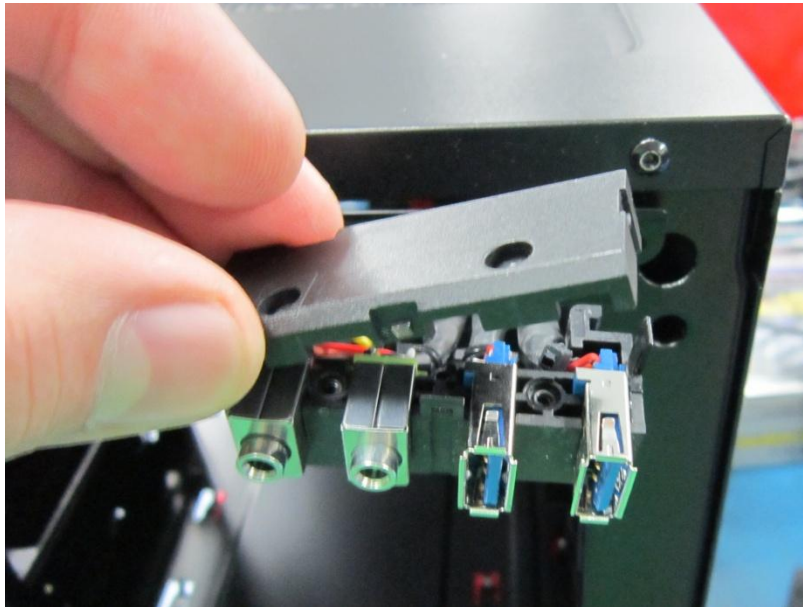

Step 7 – Once you've done this, you can see the pink (microphone) and green (headphone) connectors are reversed.

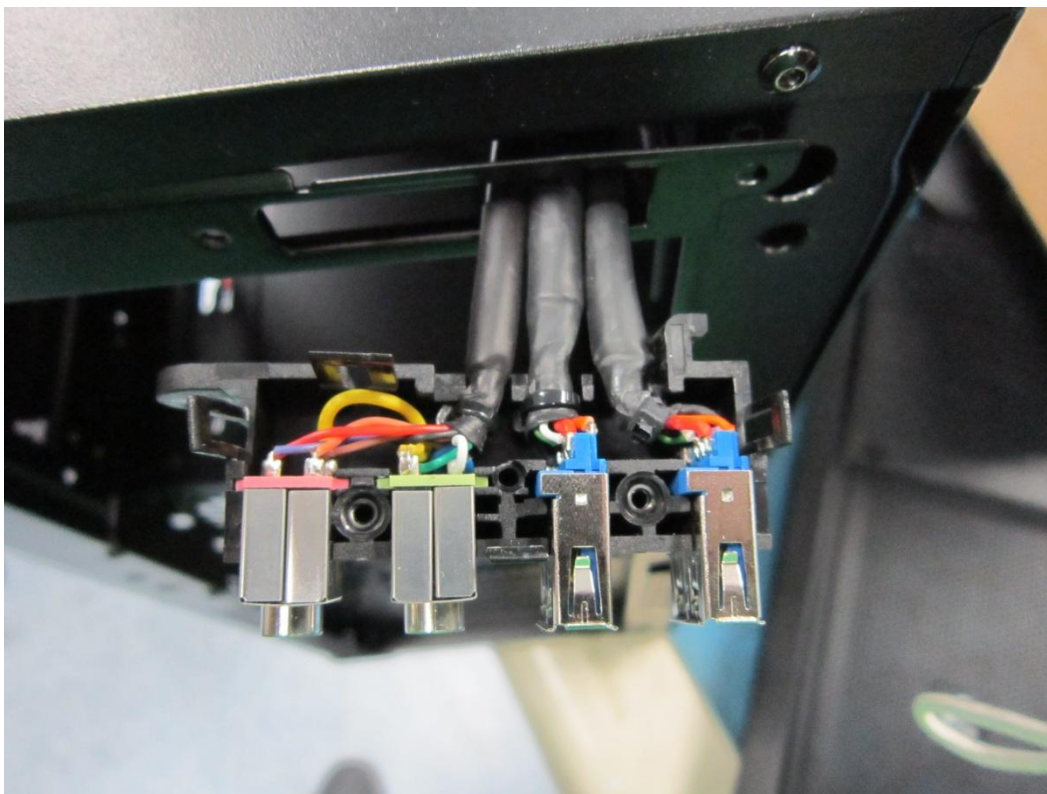

Step 8 – These are simply press-fit into place, so press from the bottom and they will pop upwards quite easily. NOTE: Be careful and use gentle pressure so as not to damage the soldered wires.



Step 9 – Once you have both of them out, reverse the connectors, press them back into place, and carefully reverse the process for re-assembly.

